



H.S.H Sport s.r.o.

Za Ženskými domovy 3/124, Praha 5, Tel: 224 827 443

e-mail: prodejnaSport: sport@hshsport.cz, velkoobchod: obchod@hshsport.cz, servis: servis@hshsport.cz, hry: info@spolecenske-hry.cz, šachy: info@sachy.biz
www.hshsport.cz, www.kupHodinky.cz, www.suunto.cz, www.polar.cz, www.timex.cz, www.spolecenske-hry.cz, www.sachy.biz, a další
IČO: 61853062, DIČ: CZ61853062, Zapsáno u Městského soudu v Praze oddíl C, vložka 31232. Banka: ČSOB 213641071 / 0300

Synchronizace a nastavení hodinek SUUNTO SPARTAN ULTRA a SW SUUNTOLINK

Aktualizace k 23.11.2016

Vážení zákazníci,

Předáváme vám aktuální doporučení, jak použít synchronizační SW SUUNTOLINK s hodinky SUUNTO SPARTAN ULTRA a SPORT.

SUUNTOLINK SW je ke stažení na http://www.movescount.com/connect/watch_sync_software

Aktuální verze Version 2.1.44 – od 3.11.2016

Pokyny SUUNTOLINK Version 2.1.31 a vyšší

Postup pro Windows 10

1. Nainstalovat SUUNTOLINK (SL)
2. Spustit SL
3. Připojit hodinky do USB
4. Připojit se k účtu MOVESCOUNT.com
5. Dále synchronizace proběhne automaticky


UPOZORNĚNÍ !!!

V současné době uživatelé, kteří jsou do Win 10 přihlášení pod jménem, které má diakritiku (např. „Přemysl Novák“) nefunguje upgrade firmware hodinek. Také se SL nespouští automaticky a proto je nutné jej spouštět ručně kliknutím na ikonu.


Firmware upgrade lze provést na počítači, kde uživatel ve jménu nemá diakritiku (např. „Premysl Novak“)

Postup pro Windows 7 - 64bit

1. Nainstalovat SUUNTOLINK (SL)
2. Spustit SL jako SPRÁVCE

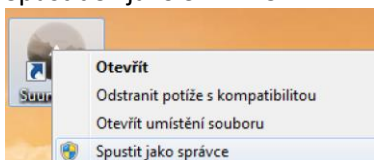

3. Potvrdit při instalaci **INSTALOVAT** a zaškrtnout **SUUNTO – vždy důvěřovat**

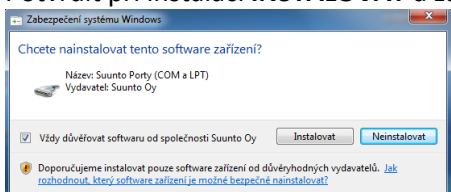

4. Připojit hodinky do USB a počkat až se vyhledá ovladač
5. Připojit se k účtu MOVESCOUNT.com
6. Dále synchronizace proběhne automaticky

Chceme Vás ujistit, že jsme v nestálém kontaktu s výrobcem a na opravě případných chyb SW se neustále pracuje.

Servisní tým SUUNTO



Suuntolink Release Notes

Version 2.1.44 3.11.2016

Minimum battery charge requirement for device software update lowered to 15%

Spartan Satellite Orbit data can be updated without connecting the device to Movescount

To improve reliability, in case an error appears while updating the firmware of the device, watch recovery uses the same firmware version as the current one in the device and will then propose update to newest version available

Watch is now detected when Suuntolink is launched automatically

Version 2.1.41 12.10.2016

Fixed issue where very long Moves could not be synchronized

Fixed issue where "Force software update" got stuck if Movescount is not available

Fixed issue where empty Movescount login was shown if Movescount is not available

Fixed missing watch background images

Watch connections are now more responsive in Suuntolink user interface

Suuntolink now prevents firmware updates from starting if watch battery level is under 30 %

We're still working on a few known issues. The amount of these issues has decreased, and our team is working on further improvements to fix them.

Errors caused by having hashtag (#) in Windows user name.

Occasional firmware update failures where Suuntolink will display an error message saying that device reset is required. If this happens, please do the following:

Disconnect the device cable

Restart Suuntolink

Reconnect the device cable

Click 'Start Device Reset' in Suuntolink

Version 2.1.36 22.09.2016

Fixed issue where user was brought back to front page after connecting to Movescount.

Fixed GPS Optimization progress bar behaviour.

We're still working on some known issues:

Synchronization of very long moves may fail. If this happens please contact customer support at www.suunto.com/support.

Version 2.1.34 08.09.2016

Fixed Spartan firmware update freezing.

Fixed Suuntolink not recognizing Spartan being disconnected.

Improved Suuntolink behaviour when disconnecting Spartan during device software update.

Added missing localizations to Help page.

Fixed Spartan synchronization progress indicator (requires Spartan Software 1.1.30).

To avoid losing data, device software updates are offered only after device has been synchronized.

We're still working on some known issues:

Errors caused by having hashtag (#) in Windows user name.

Occasional firmware update failures where Suuntolink will display an error message saying that device reset is required. If this happens, please do the following:

Disconnect the device cable

Restart Suuntolink

Reconnect the device cable

Click 'Start Device Reset' in Suuntolink

Version 2.1.31 25.08.2016

With the help of feedback from our customers, we have addressed the following findings:

Added support for 32 bit Windows systems.

Spartan device recognition improved: USB device name handling fixed.

Fixed error cases caused by language specific (non-UTF8) characters in Windows user names.

We're still working on some known issues:

Firmware update process freezes occasionally. After 15 minutes the device should be unplugged, Suuntolink restarted and process retried.

Errors caused by having hashtag (#) in Windows user name.

Version 2.1.27 12.08.2016

OS X USB connectivity fixed in older Macbooks.

User data is restored to the watch after watch software update.

Version 2.1.25 11.08.2016

Updated translations.

Version 2.1.20 21.07.2016

Updated look and feel of Suuntolink."